

East Tester[®]

ET3241 4¹/₂ Benchtop Digital Multimeter

ET3241B 4³/₄ Benchtop Digital Multimeter

ET3242 4⁴/₅ Benchtop Digital Multimeter

ET3243 4⁵/₆ Benchtop Digital Multimeter

User's Manual



Hangzhou Zhongchuang Electronics Co., Ltd.

Hangzhou Zhongchuang Electronics Co., Ltd.

Address: NO. 3 Kangle Road, Gongshu District, Hangzhou Postcode: 310015

Telephone: 0571-56861333

Fax: 0571-56861355

Website: <http://www.cnheader.com>

<http://www.easttester.com>

QQ: 2853705707, 2853705708

Table of Contents

1 Safety Precautions.....	1
2 Introduction.....	2
2.1 Main features.....	3
2.2 General features.....	4
3 Quick reference.....	4
3.1 check the accessories of the product.....	4
3.2 Appearance of the front panel.....	4
3.3 Display interface.....	5
3.4 Keys introduction.....	5
3.4.1 Power Switch key.....	5
3.4.2 Arrow keys.....	5
3.4.3 Basic measurement function keys.....	5
3.4.4 Mathematic function keys.....	6
3.4.5 Additional function keys.....	6
3.4.6 Second function key combination.....	7
3.5 Rear panel introduction.....	8
3.6 Adjust the handle.....	8
3.7 Turn on the multimeter.....	8
4 Basic measurement function.....	9
4.1 Voltage measurement.....	9
4.1.1 DC Voltage measurement.....	9
4.1.2 AC voltage measurement.....	10
4.2 Current measurement.....	10
4.2.1 DC current measurement.....	10
4.2.2 AC current measurement.....	11
4.3 Resistance measurement.....	12
4.3.1 2-wire resistance measurement.....	12
4.3.2 4-wire resistance measurement.....	13
4.4 Frequency measurement and period measurement.....	13
4.4.1 Frequency measurement.....	13
4.4.2 Period measurement.....	14
4.5 Diode measurement and on-off measurement.....	14
4.5.1 Diode measurement.....	14
4.5.2 On-off measurement.....	15
4.6 Capacitance measurement.....	15
4.7 Duty cycle measurement.....	16
5 Additional measurement function.....	16
5.1 Max and Min.....	16
5.2 MX+B.....	17
5.3 dB and dBm.....	17
5.4 REL.....	18
5.5 COMP HI and COMP LOW.....	18
5.6 Statistics.....	19
5.7 Data storage and readback.....	20
5.8 Graphic display.....	20

5.8.1 Bar Meter.....	21
5.8.2 Trend Chart.....	21
5.8.3 Histogram.....	21
5.9 Temperature.....	22
5.10 Customize the sensor.....	23
5.10.1 New sensor.....	23
5.10.2 Save.....	25
5.10.3 Recall.....	25
6 System settings.....	25
6.1 Language switch.....	26
6.2 Buzzer switch.....	26
6.3 Screen brightness adjustment.....	26
6.4 Interface style selection.....	26
7 Technical indicators.....	26
7.1 DC Voltage.....	26
7.2 AC Voltage(True RMS).....	26
7.3 DC Current.....	27
7.4 AC Current.....	27
7.5 Resistance.....	28
7.6 Capacitance.....	29
7.7 Frequency.....	29
7.8 Diode.....	29
7.9 Conductance.....	29
7.10 Duty Cycle.....	30
7.11 Temperature.....	30
8 Calibration.....	30
8.1 DC voltage calibration.....	30
8.2 AC voltage calibration.....	32
8.3 DC current calibration.....	32
8.4 AC current calibration.....	33
8.5 Resistance calibration.....	33
8.6 Capacitance calibration.....	34
9 Communication Interface.....	34
10 Related software installation and use.....	35
11 Maintenance and upkeep.....	35
11.1 General maintenance and repair.....	35
11.2 Replace the fuse.....	35

1 Safety Precautions

To avoid personal injury and prevent damage to the instrument, be sure to use this instrument in accordance with the manual. Before fully understanding and meeting the following warning, do not proceed to the next step.

Safety ground:

Connect the power cord of the instrument to a grounded socket. Make sure that the instrument is reliably grounded.

Use proper fuse:

Please use only fuses of the specified type and rating.

Proper use of lead set:

Do not use damaged or worn test lead set. When using probes, the finger should be kept behind the finger protector of the probe. When wiring, you should connect the common line first and then connect the charged test lead. When disconnecting, disconnect the charged test lead first.

If the instrument malfunctions, do not use:

Its protection may be impaired, do not install substitute parts or conduct unauthorized adjustment of the instrument. Please return the instrument for repair or professional inspection to ensure their safety features.

Do not use this instrument at high temperature, or environment with explosives or strong electromagnetic field.

Do not change the wiring inside the instrument, so as not to cause damage to the instrument or endanger the safety.

When measuring, you must select the correct measurement function and the measurement range.

Before the function range is switched, disconnect the probe and the circuit under test to prevent damage to the instrument.

Protect limits:

Without exceeding the protection limits, the protection circuit of this instrument prevents damage to the instrument and shock hazard. To ensure the safe operation of the instrument, do not exceed the marked limits for protection on front and rear panels.

IEC measurement type II overload protection:

To avoid the risk of electric shock, this instrument provides overload protection for the mains under the following two conditions:

- 1) HI and LO input terminals under the condition of the measurement type II (as described below) are connected to mains.
- 2) The maximum line voltage of mains is 300 VAC.

In order to avoid blown fuse or damage to the meter, be sure to follow these tips to use the current input terminals.

- 1) 12 A and 200mA(ET3241)/ 400mA(ET3241B)/ 500mA(ET3242)/ 600mA(ET3243) input terminals are not allowed to simultaneously connect to the current measurement circuit.
- 2) If the effective value of the measured current AC + DC is within the range from 200mA(ET3241)/400mA(ET3241B)/500mA(ET3242)/ 600mA(ET3243) to 12 A, only 12A and LO terminals are allowed to be used in the measurement.
- 3) Before performing current measurement, be sure to select the correct current input terminal according to the expected current size.

4) The current input to the terminal 12 A must not exceed 12A; otherwise, the internal fuse inside the multimeter will blow; and the current input to 200mA(ET3241)/ 400mA(ET3241B) /500mA (ET3242) / 600mA(ET3243) terminal must not exceed 500mA(ET3241/ET3241B) /1A(ET3242/ET3243); otherwise, the current input fuse on the rear panel will blow.

Warning:

IEC measurement type II includes the electrical device one of whose sockets on the branch circuit is connected to mains. Such devices include most small appliances, test equipment, and other equipment inserted into the branch socket.

The voltage higher than 300 VAC can only be measured in the circuit with the mains cut off. However, there is transient overvoltage in the circuit with the mains cut off. This instrument can withstand up to 2500 Vpk of occasional transient overvoltage safely. Do not use this instrument to measure the circuit with a transient overvoltage higher than this level.

This instrument can be used for such measurements: HI and LO inputs are connected to mains of such devices (up to 300 VAC), or to the branch outlet. However, the HI and LO inputs terminals of this instrument cannot be connected to the mains in the permanently installed electrical devices, such as the main circuit-breaker panel, sub-panel fuse boxes, or permanently wired motors. Such devices and circuits can easily exceed the limit of this instrument for overload protection.

Environment related notes:

This instrument complies with the requirements on marking under WEEE Directive (2002/96 / EC). According to the label on the instrument (see below), do not dispose the electrical / electronic equipment along with household waste together.

This instrument may contain substances that might be harmful to the environment or human health; in order to avoid the release of hazardous substances into the environment or harm to human health, we recommend the use of appropriate methods to recycle this instrument in order to ensure that most of the materials are reused or recycled. For disposal or recycling related information, please contact the local authorities.




Instrument category:


According to Appendix 1 of the WEEE Directive, the instrument is classified as a "monitored and controlled instrument".

Signs on the product:

The following signs might be seen on the instrument:

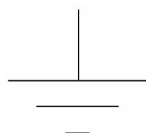

Signal ground

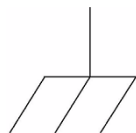

chassis ground



High voltage



Refer to Manual

Limited warranty and liability.

The company is responsible for free repair or replacement within one year from the date of purchase, but does not include damage to fuse and damage caused by human factors.

2 Introduction

ET324X is a series of dual digital benchtop true RMS multimeter. The STM32 chip and external

double integral AD used by this series benchtop multimeter providing accurate measurement and stable performance. 3.5 inch 320 * 480 high resolution TFT LCD screen makes a clear reading, rich display, and a good visual effects. This series benchtop multimeter are powered by electricity and provide full-function, full-range overload protection. Fresh and simple design with excellent performance makes them an ideal choice for electricians, electronics enthusiasts, engineers and colleges and universities.

2.1 Main features

- 3.5-inch 320 * 480 TFT LCD.
- Dual parameter display: it can display two parameters of the same input signal.
- Measurement rate: FAST (7 times / second), MID (5 times / sec), SLOW (2 times / sec).
- 12 basic measurement functions: AC and DC voltage, AC and DC current, two-wire / four-wire resistance, period / frequency, diode, on-off test, capacitance, duty cycle.
- DCV basic accuracy: 0.02%.
- keys can be locked.
- Open calibration function.
- Provide system settings, can configure the language, buzzer, screen brightness, interface display style.
- ET324X series multimeter parameters as shown in the following table:

Mode	ET3241	ET3241B	ET3242	ET4243	Max range
	Accuracy				
Maximum display	22000 counting (4 1/2 digits)	44000 counting (4 3/4 digits)	55000 counting (4 4/5 digits)	66000 counting (4 5/6 digits)	
DC voltage	$\pm(0.02\%+3)$	$\pm(0.02\%+3)$	$\pm(0.02\%+3)$	$\pm(0.02\%+3)$	1100V
DC current	$\pm(0.1\%+3)$	$\pm(0.05\%+3)$	$\pm(0.05\%+3)$	$\pm(0.05\%+3)$	12A
AC voltage	$\pm(0.2\%+20)$	$\pm(0.2\%+20)$	$\pm(0.2\%+20)$	$\pm(0.2\%+20)$	800V
AC current	$\pm(0.3\%+3)$	$\pm(0.3\%+3)$	$\pm(0.3\%+3)$	$\pm(0.3\%+3)$	12A
Resistance	$\pm(0.05\%+5)$	$\pm(0.04\%+5)$	$\pm(0.03\%+5)$	$\pm(0.03\%+5)$	1G Ω
Capacitance	$\pm(2\%+5)$	$\pm(2\%+5)$	$\pm(2\%+5)$	$\pm(2\%+5)$	10mF
Frequency	$\pm(0.05\%+3)$	$\pm(0.02\%+8)$	$\pm(0.01\%+3)$	$\pm(0.01\%+3)$	20MHz
Others					
Continuity test	When the resistance is less than 30 ohms, the buzzer sounds.				
Diode	Measuring range: 0 ~ 2V.				
Period	Support.				
Display type	Trend chart, Histogram, Bar Meter.				
Duty cycle measurement	5.0% ~ 95.0%(Error within 10 words).				
Customize the sensor	Users can customize the relationship curve, through the U disk or USB communication port to download, support up to 20 kinds.				
Limit test	Support.				
AC+DC measurement	Support.				
Resistance measurement	2-wire measurement / 4-wire measurement.				
Square wave output	Frequency: 1Hz ~ 100kHz, amplitude: 3V.(optional)				
Trigger mode	Standard: automatic trigger, single trigger; Optional: external trigger.				
Mathematical functions	MX+B/MAX/MIN/dB/dBm/Rel/Comp Hi/Comp Low/ Hold/Statistics.				

Additional functions	Data hold, data storage, data readback.
Temperature	Thermocouple: K/N/R/S/T/B/E/J/WRe325/WRe526; Thermal resistance: PT100 /PT50 / Cu100 / Cu50.
Communication Interface	Standard: USB Device; Optional: RS232, USB Host, GPIB, LAN, WIFI, Bluetooth.

Table 2-1 Comparison of ET324X Series Multimeter Parameters

2.2 General features

1. Power supply voltage: 220V AC \pm 10%, 110V AC \pm 10%, 45-65Hz.
2. Working environment: 0~40°C, relative humidity <80%.
3. Storage environment: -10~50°C, relative humidity <80%.
4. Dimensions: 265mm*105mm*305mm(width*height*depth).
5. Weight: 2.3kg.

3 Quick reference

3.1 check the accessories of the product

Confirm the following accessories of the multimeter, among which the optional accessories are delivered if only ordered. If any items are missing, please contact the nearest sales office.

Standard accessories:

- A pair of probes.
- A double end three-wire power line.
- Two backup power fuse.
- User manual.

Optional accessories:

- RS232 serial line.
- USB cable.
- GPIB cable.
- Cable.

Standard and optional function/information of communication interface:

Standard communication interface	USB Device
Optional communication interface	RS232, GPIB, USB Host, LAN, WIFI, Bluetooth
Optional function	Square wave output, External trigger

3.2 Appearance of the front panel

ET324X series benchtop multimeter front panel as shown in Figure 3-1, the regional description see Table 3-1.

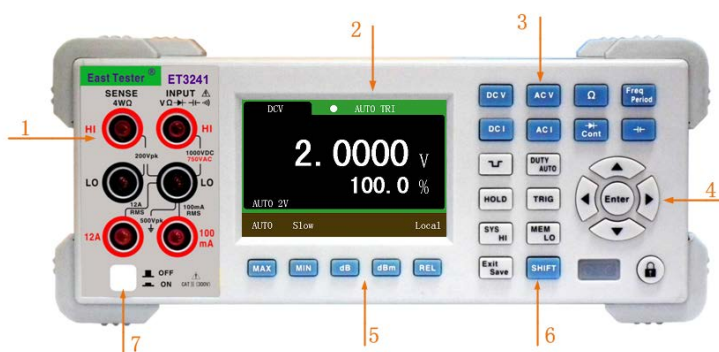


Figure 3-1 Front panel diagram

NO.	Description
1	Measurement terminal of multimeter.

2	Display screen.
3	Basic measurement function keys.
4	Arrow keys.
5	Mathematical function keys.
6	Additional function keys.
7	Power key.

Table 3-1 Front panel area description

3.3 Display interface

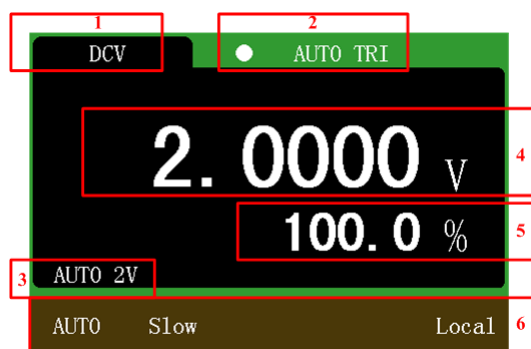


Figure 3-2 Interface of the display

NO.	Description
1	Displays the name of the current measurement function.
2	Display Trigger Mode: Auto Trigger, Single Trigger, External Trigger.
3	Display only in automatic mode, indicate the currently range.
4	Main display area. Displays the current measured value.
5	Secondary display area. Displays additional information about the current measured value.
6	The configuration area of the current measurement function. Display range, measurement speed, additional functions, local / remote information.


Figure 3-3 Description of the interface area


3.4 Keys introduction

3.4.1 Power Switch key


 Turn On / Off the main power.


3.4.2 Arrow keys

 Up arrow key.

 Down arrow key.

 Enter key.

 Left arrow key.

 Right arrow key

3.4.3 Basic measurement function keys

 DC voltage measurement key.

 AC voltage measurement key.

 DC current measurement key.

 AC current measurement key.



2-wire / 4-wire resistance measurement key.



Capacitance measurement key.



Frequency / period measurement key.



Diode / on-off measurement key.

3.4.4 Mathematic function keys



Maximum measurement key. When the key is pressed, the maximum value of the measured value since the maximum measurement function is turned on will be displayed on the secondary display area.



Minimum measurement key. When the key is pressed, the minimum value of the measured value since the minimum measurement function is turned on will be displayed on the secondary display area.



dB measurement key. In the voltage (DC voltage, AC voltage) measurement function, press the key, the dB value of the measured value will be displayed on the secondary display area. The reference voltage can be modified, the default is 1V.



dBm measurement key. In the voltage (DC voltage, AC voltage) measurement function, press the key, the dBm value of the measured value will be displayed on the secondary display area. The reference resistance can be modified, the default is 600Ω.



Relative value measurement key. In the voltage (DC voltage, AC voltage), current (DC current, AC current), resistance (two-wire resistance, four-wire resistance), frequency, period, capacitance measurement function, press the key, the measured value will be subtracted from the relative value in the secondary display area and displayed in the main display. In the main value = the measured value - the relative value. Relative value can be modified.

3.4.5 Additional function keys



Square wave output key. Press the key, a amplitude fixed, frequency adjustable square wave will be output from the rear panel.



Duty cycle measurement key. Press the key to turn on the duty cycle measurement function.



Automatic key. In manual range mode, press the key to switch to auto range. In external trigger / single trigger mode, press the key to change the trigger mode to auto trigger.



Single trigger key. Press the key to change the multimeter measurement mode to single trigger. Each time the key is pressed, the meter measures once and displays a reading.



Save key. Press the key to save the relevant information of the current measured value; press the key again to exit the data save function.



Data read back key. Press this key to enter the data readback function. Press any of the basic measurement function keys to exit the data readback function. The data readback function displays relevant information about the measured values that have been stored. Press the up / down arrow key to select the measured values for a specific sequence number.



System settings key. Press the key to view the instrument model, serial number, version number, but also can set the language, switch buzzer, adjust the screen brightness, switch the interface display style.

3.4.6 Second function key combination



Reading hold function key combination. Press the key combination, the instrument readings remain unchanged, press the key combination again to exit the reading hold function.



AC + DC measurement function key combination Press the key combination to start AC + DC signal measurement, press the key combination again to exit AC + DC measurement function.



External trigger function key combination. Press the key combination to turn on the external trigger measurement mode. In this mode, when the external trigger terminal enters a negative pulse, the meter measures once and displays a reading. (Optional function)



Calibration function key combination. In the voltage (DC voltage, AC voltage), current (DC current, AC current), resistance (two-wire resistance, four-wire resistance), capacitance measurement function, press the key combination to enter the corresponding calibration function. Press any of the basic measurement function keys to exit the calibration function.



Upper limit comparison function key combination. In the voltage (DC voltage, AC voltage) measurement function, press the key combination to turn on the upper limit comparison function. The upper limit comparison value can be modified, the default is 1V.



Lower limit comparison function key combination. In the voltage (DC voltage, AC voltage) measurement function, press the key combination to turn on the lower limit comparison function. Lower limit value can be modified, the default is 1V.



Exit key. Press this key to switch from the current measurement function to the basic measurement function before the last function switch.



MX + B function key combination. In the voltage (DC voltage, AC voltage), current (DC current, AC current), resistance (two-wire resistance, four-wire resistance), frequency, period, capacitance measurement function, press the key combination to turn on the MX + B measurement function. Press the key to exit the MX + B function.



Customize the sensor function key combination. Press the key combination to turn on the custom sensor function, the user can customize the sensor.



Select the display type key combination. In the voltage (DC voltage, AC voltage),

current (DC current, AC current), resistance (two-wire resistance, four-wire resistance), capacitance measurement function, press the key combination to select the display type of the measured value, you can select the numerical display, bar graph display, trend display and histogram display.



The temperature measurement function key combination. Press the key

combination to turn on the temperature measurement function. Depending on the type of temperature sensor used, press the up / down / left / right arrow key to select the corresponding temperature sensor type for temperature measurement.



Statistical function key combination. In the voltage (DC voltage, AC voltage),

current (DC current, AC current), resistance (two-wire resistance, four-wire resistance), capacitance measurement function, press the key combination to open the statistical function. Press again to exit the statistics function.

3.5 Rear panel introduction



Figure 3-4 Rear panel diagram (standard part only)

NO.	Description
1	Power jack: AC 220V / 50Hz power supply input socket.
2	Power fuse: 0.5A / 250V fuse.
3	Voltage selector: 110V / 50Hz VAC or 220V / 50Hz VAC.
5	USB Device interface.
7	External trigger measurement port.
8	Current input fuse: 0.5A / 250V(ET3241, ET3241B), 1A/250V (ET3242, ET3243).

Table 3-2 Description of the rear panel

3.6 Adjust the handle

To adjust the handle of the digital multimeter, hold the handle on both sides of the body and pull it outward. Then rotate the handle to the desired position. The operation method is shown in Figure 3-5. The multimeter can be placed as shown in Figure 3-6, and the location of the carrying as shown in Figure 3-7.



Figure 3-5 Adjust handle

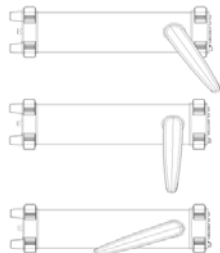


Figure 3-6 Working position



Figure 3-7 Carrying position

3.7 Turn on the multimeter

Connect the AC power supply

1. Multimeter power supply can choose 110V or 220V, adjust the power supply voltage selector on

the rear panel of the multimeter according to the supply voltage.

2. Use the provided power cord to connect the multimeter to AC power.

Start the multimeter

Press the power switch key.

If the instrument does not start normally, follow the steps below to check:

1. Check if the power cord is in good contact.
2. Check if the power switch key is pressed.
3. Check if the power fuse has been blown, replace the fuse, if necessary.
4. If the above check is correct, the instrument has not yet started, please contact the relevant departments.

4 Basic measurement function



Warning:

- 1) Before measuring, make sure the wiring is correct. In order to avoid damage to the multimeter, and possible personal safety hazards, do not measure the voltage beyond the rated input limit.
- 2) After the voltage up to 1100 VDC is measured, it is better to wait for about 2 minutes, and then conduct the low voltage measurement with the resolution rate 1 to 10 μ V.
- 3) After using the A input terminal for measuring high currents, it is better to wait for about 10 minutes, and then conduct the low-level DC measurements (volts, amps, or ohms) in order to achieve accuracy. The reason is that measuring the thermal voltage generated by the high current may cause errors in the low-level measurements.
- 4) After the completion of all measurements, disconnect the probe and the circuit under test and remove the probe from the input terminal of the instrument.
- 5) When measuring the high voltage and high current, pay special attention to safety.

Because ET3241, ET3241B, ET3242, ET3243 share the same measurement method, the measurement will be explained by taking the operation of ET3241 as an example.

4.1 Voltage measurement

4.1.1 DC Voltage measurement

1. Press  to select the DC voltage measurement function. The measurement interface is shown in Figure 4-1.
2. Connect the red and black test leads to the corresponding input terminals as shown in Figure 4-2.
3. Press the up / down arrow key to manually select the appropriate range or select the auto range mode by pressing , press the left / right arrow key to select the appropriate measurement speed.
4. Start the measurement.

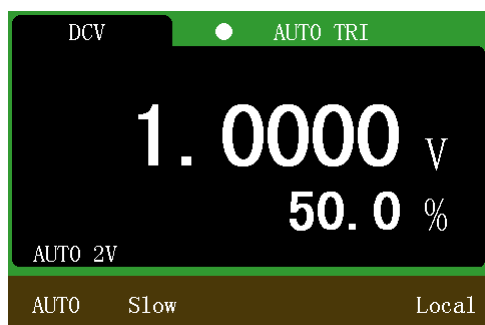


Figure 4-1 Measurement interface

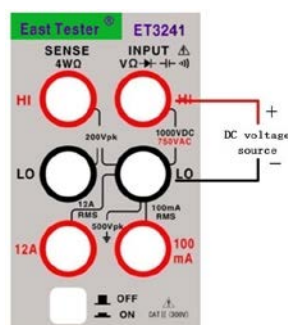

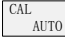


Figure 4-2 Wiring method

Note:

- 1) The measured voltage value is displayed in the main display area, and the value in the secondary display area represents the ratio of the current measured value to the full scale value.
- 2) Full range input protection: 1100V DC.

4.1.2 AC voltage measurement

1. Press  to select the AC voltage measurement function. The measurement interface is shown in Figure 4-3.
2. Connect the red and black test leads to the corresponding input terminals as shown in Figure 4-4.
3. Press the up / down arrow key to manually select the appropriate range or select the auto range mode by pressing , press the left / right arrow key to select the appropriate measurement speed.
4. Start the measurement.

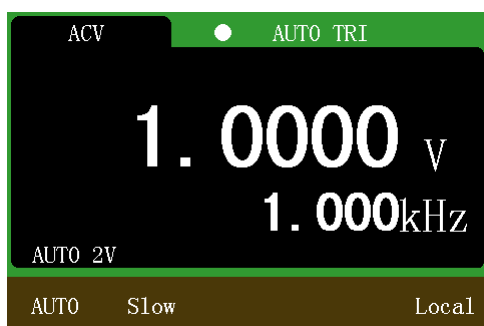


Figure 4-3 Measurement interface

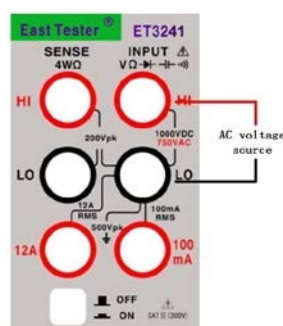


Figure 4-4 Wiring method


Note:

- 1) The measured voltage value is displayed in the main display area, and the value in the secondary display area represents the measured frequency of the current input signal.
- 2) To ensure accuracy, the input value should be greater than 10% of the range, and not higher than the range of 90%.
- 3) Full range input protection: 800V RMS.

4.2 Current measurement**Note:**

- 1) The fuse used for low current measurement is 0.5A 250V (ET3241, ET3241B) / 1A 250V (ET3242/ ET3243) and 12A 250V for high current measurement.
- 2) Try to avoid high current for a long time continuous measurement, pay attention to the protection of personal safety.
- 3) Low current measurement in the automatic mode does not switch to a higher current range, please pay attention to the timely adjustment of the input terminal wiring.
- 4) High current measurement in the automatic mode does not switch to a lower current range, please pay attention to the timely adjustment of the input terminal wiring.

4.2.1 DC current measurement

1. Press  to select the DC current measurement function. The measurement interface is shown in Figure 4-5.

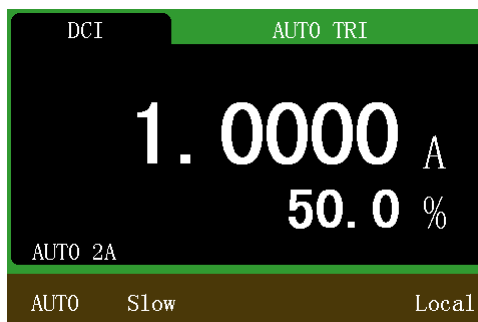


Figure 4-5 Measurement interface

Note:

The measured current value is displayed in the main display area, and the value in the secondary display area represents the ratio of the current measured value to the full scale value.

2. Choose different test terminals according to the measurement level. See Figure 4-6 for current of 200mA(ET3241)/ 400mA(ET3241B)/ 500mA(ET3242)/ 600mA(ET3243)and below, and connect the red and black test leads respectively to the proper input terminals. See Figure 4-7 for current from 200mA (ET3241)/ 400mA(ET3241B)/ 500mA(ET3242)/ 600mA(ET3243) to 12A, and connect the red and black test leads respectively to the proper input terminals.

3. Press the up / down arrow key to manually select the appropriate range or select the auto range mode by pressing , press the left / right arrow key to select the appropriate measurement speed.

4. Start the measurement.

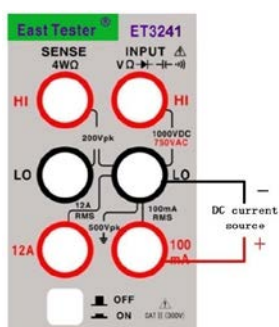


Figure 4-6 Wiring method for low current measurement

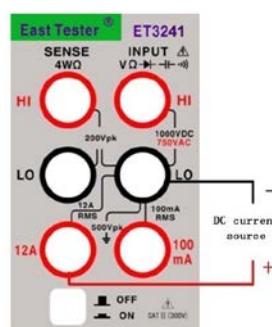


Figure 4-7 Wiring method for high current measurement

4.2.2 AC current measurement

1. Press to select the AC current measurement function. The measurement interface is shown in Figure 4-8.

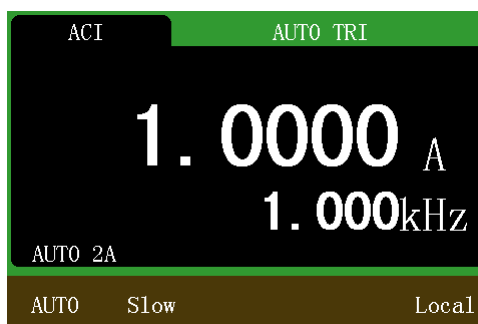
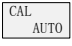


Figure 4-8 Measurement interface

Note:

- The measured current value is displayed in the main display area, and the value in the secondary display area represents the measured frequency of the current input signal.
- Choose different test terminals according to the measurement level. See Figure 4-9 for current of 200mA(ET3241)/ 400mA(ET3241B)/ 500mA(ET3242)/ 600mA(ET3243)and below, and connect the red and black test leads respectively to the proper input terminals. See Figure 4-10 for current from 200mA (ET3241)/ 400mA(ET3241B)/ 500mA(ET3242)/ 600mA(ET3243) to 12A, and connect the red and black test leads respectively to the proper input terminals.
 - Press the up / down arrow key to manually select the appropriate range or select the auto range mode by pressing , press the left / right arrow key to select the appropriate measurement speed.
 - Start the measurement.

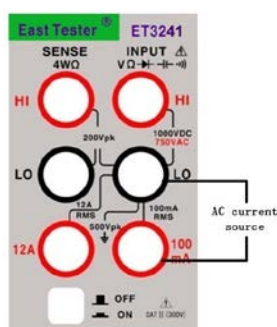


Figure 4-9 Wiring method for low current measurement

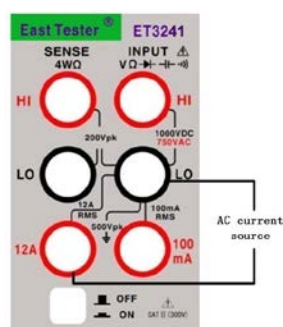


Figure 4-10 Wiring method for high current measurement

4.3 Resistance measurement

Note:

- Before measuring the resistance, disconnect the circuit power and discharge all high-voltage capacitors to avoid damages to the multimeter.
- In the case of 2-wire resistance measurement, the relative function can be considered in order to eliminate the error caused by the lead resistance.
- 200M Ω and higher range readings beating is a normal phenomenon.

4.3.1 2-wire resistance measurement



- Press  to select the 2-wire resistance measurement function by default. The measurement interface is shown in Figure 4-11.
- Connect the red and black test leads to the corresponding input terminals as shown in Figure 4-12.
- Press the up / down arrow key to manually select the appropriate range or select the auto range mode by pressing the , press the left / right arrow key to select the appropriate measurement speed.
- Start the measurement.



Figure 4-11 Measurement interface

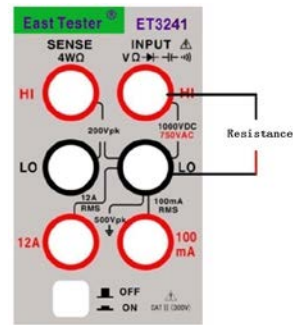
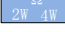



Figure 4-12 Wiring method

Note:

The measured resistance value is displayed in the main display area, and the value in the secondary display area represents the ratio of the current measured value to the full scale value.

4.3.2 4-wire resistance measurement

1. In the 2-wire resistance measurement function, press  again to select the 4-wire resistance measurement function. The measurement interface is shown in Figure 4-13.
2. Connect the red and black test leads to the corresponding input terminals as shown in Figure 4-14.
3. Press the up / down arrow key to manually select the appropriate range or select the auto range mode by pressing , press the left / right arrow key to select the appropriate measurement speed.
4. Start the measurement.

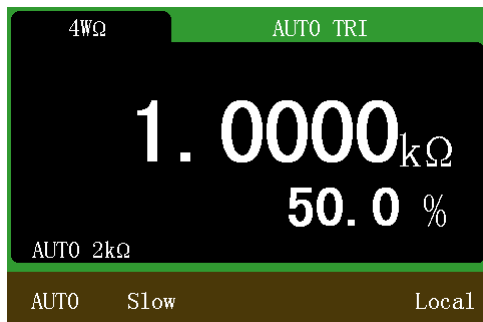


Figure 4-13 Measurement interface

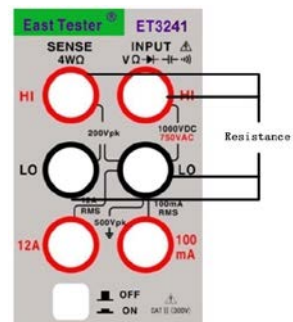


Figure 4-14 Wiring method

Note:

The measured resistance value is displayed in the main display area, and the value in the secondary display area represents the ratio of the current measured value to the full scale value.

4.4 Frequency measurement and period measurement

4.4.1 Frequency measurement

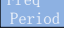

1. Press  to select the frequency measurement function by default. The measurement interface is shown in Figure 4-15.
2. Connect the red and black test leads to the corresponding input terminals as shown in Figure 4-16.
3. Press the up / down arrow key to manually select the appropriate range or select the auto range mode by pressing .
4. Start the measurement.



Figure 4-15 Measurement interface

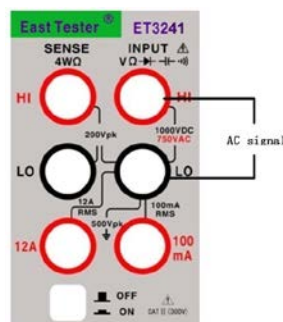


Figure 4-16 Wiring method

4.4.2 Period measurement

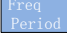

1. In the frequency measurement function, press  again to select the period measurement function. The measurement interface is shown in Figure 4-17.
2. Connect the red and black test leads to the corresponding input terminals as shown in Figure 4-18.
3. Press the up / down arrow key to manually select the appropriate range or select the auto range mode by pressing .
4. Start the measurement.



Figure 4-17 Measurement interface

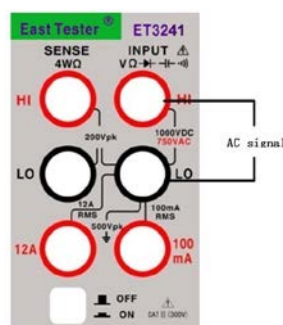


Figure 4-18 Wiring method

4.5 Diode measurement and on-off measurement

Test conditions: the forward DC current is approximately 1mA, and the reverse DC voltage no higher than 3V.

4.5.1 Diode measurement


1. Press  to select the diode measurement function by default. "OPEN" is displayed when the voltage value is higher than the measuring threshold, and the measured voltage is displayed when the measured value is below the measuring threshold. The diode threshold voltage is 3.2V. The measurement interface is shown in Figure 4-19.
2. Connect the red and black test leads to the corresponding input terminals as shown in Figure 4-20.
3. Start the measurement.



Figure 4-19 Measurement interface

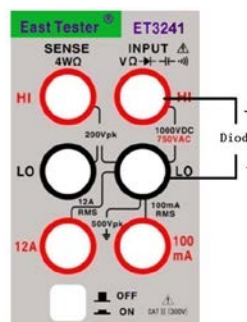


Figure 4-20 Wiring method

4.5.2 On-off measurement


1. In the diode measurement function, press  again to select the on-off measurement. "OPEN" is displayed when the measured resistance value is greater than the resistance threshold, and the measured resistance value is displayed when the measured resistance value is less than the resistance threshold. When the measured resistance is less than 30Ω, the buzzer sounds. The on-off resistance threshold is 1kΩ. The measurement interface is shown in Figure 4-21.
2. Connect the red and black test leads to the corresponding input terminals as shown in Figure 4-22.
3. Start the measurement.



Figure 4-21 Measurement interface

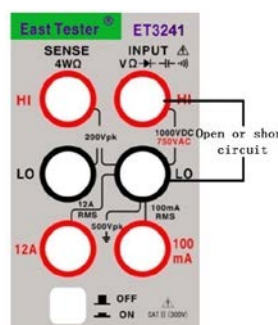
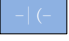



Figure 4-22 Wiring method

4.6 Capacitance measurement

1. Press  to select the capacitance measurement function. The measurement interface is shown in Figure 4-23.
2. Connect the red and black test leads to the corresponding input terminals as shown in Figure 4-24.
3. Press the up / down arrow key to manually select the appropriate range or select the auto range mode by pressing , press the left / right arrow key to select the appropriate measurement speed..
4. Start the measurement.

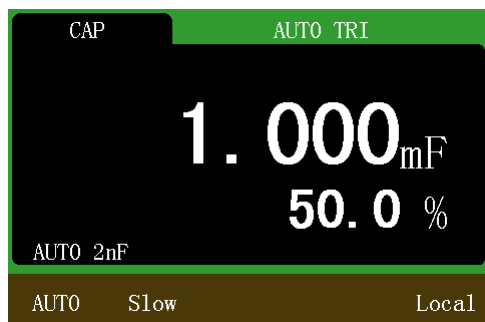


Figure 4-23 Measurement interface

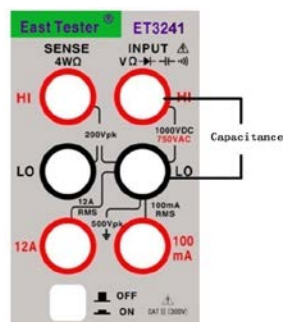


Figure 4-24 Wiring method

Note:

- 1) The measured capacitance value is displayed in the main display area, and the value in the secondary displayed area represents the ratio of the current measured value to the full scale value.
- 2) When measuring large capacitance, the measurement time is slightly longer due to the charge and discharge of the capacitor.

4.7 Duty cycle measurement

1. Press to select the duty cycle measurement function. The measurement interface is shown in Figure 4-25.
2. Connect the red and black test leads to the corresponding input terminals as shown in Figure 4-26.
3. Start the measurement.

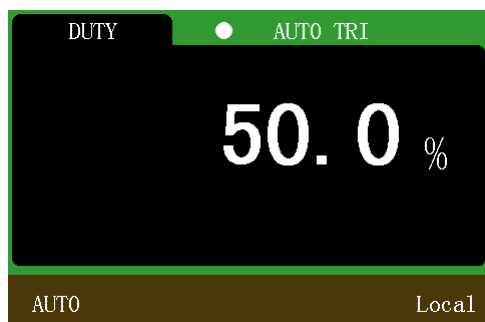


Figure 4-25 Measurement interface

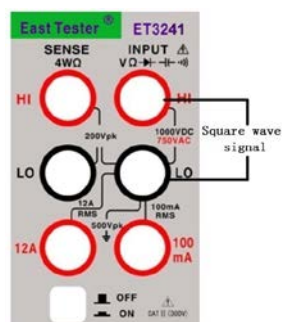


Figure 4-26 Wiring method

5 Additional measurement function

Additional measurement functions are only available in numeric display mode.

5.1 Max and Min

In the voltage (DC voltage, AC voltage), current (DC current, AC current), resistance (2-wire resistance, 4-wire resistance), frequency, period, capacitance measurement function:

1. Press to record the maximum value of the measurement, as shown in Figure 5-1. Press again to exit the maximum value measurement function.
2. Press to record the minimum value of the measurement, as shown in Figure 5-2. Press again to exit the minimum measurement function.

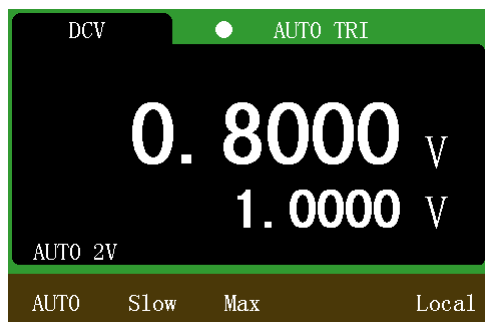


Figure 5-1 Maximum measurement interface

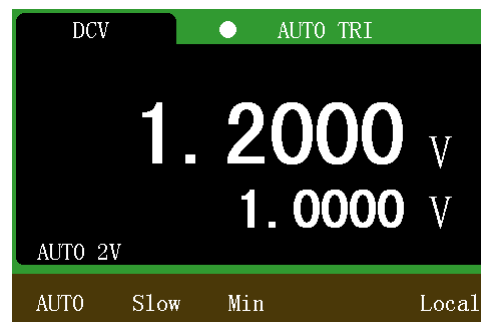


Figure 5-2 Minimum measurement interface

5.2 MX+B

In the voltage (DC voltage, AC voltage), current (DC current, AC current), resistance (2-wire resistance, 4-wire resistance), frequency, period, capacitance measurement function:

Press **SHIFT** + **MAX** key combination to select the MX + B function, as shown in Figure 5-3.

Press the key combination again to exit the MX + B function.

Note:

- 1) Formula: $Y = M * X + B$, where Y is the value displayed in the secondary display area. M is a monomial coefficient, B is a constant.
- 2) In the interface shown in Figure 5-3, press the Enter key to call up the M value modification interface, as shown in Figure 5-4. The value of M can be modified by the use of up / down / left / right arrow key.
- 3) In the interface shown in Figure 5-4, press the Enter key to call up the B value modification interface. The value of B can be modified by the use of up / down / left / right arrow key.

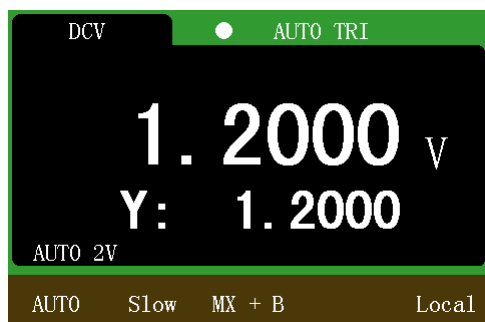


Figure 5-3 MX + B measurement interface

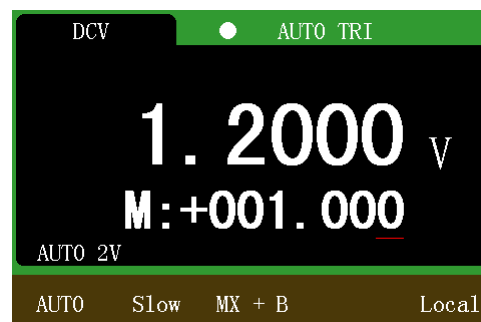


Figure 5-4 M value modified interface

5.3 dB and dBm

In the voltage (DC voltage, AC voltage) measurement function:

1. Press **dB** to select the dB measurement function, as shown in Figure 5-5. Press **dB** again to exit the dB measurement function.
2. Press **dBm** to select the dBm measurement function, as shown in Figure 5-7. Press **dBm** again to exit the dBm measurement function.
3. In the interface shown in Figure 5-5, press the Enter key to call up the dB reference voltage setting interface. The up / down / left / right array key can be used to modify the value of the dB reference voltage, as shown in Figure 5-6.
4. In the interface shown in Figure 5-7, press the Enter key to call up the dBm reference voltage setting interface. The up / down / left / right array key can be used to modify the value of the dBm

reference voltage, as shown in Figure 5-8.

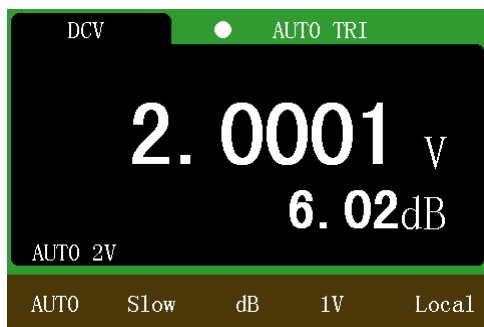


Figure 5-5 dB measurement interface

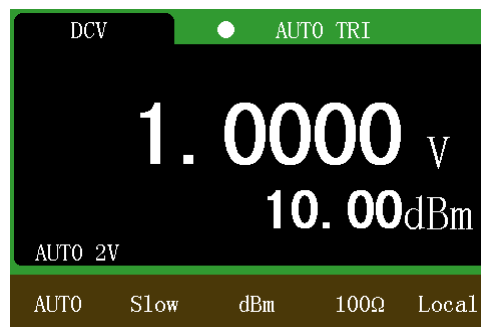


Figure 5-7 dBm measurement interface

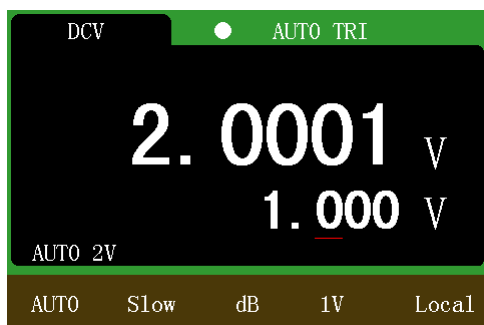


Figure 5-6 dB reference voltage modified interface



Figure 5-8 dBm reference resistance modified interface

Note:

- 1) $\text{dBm} = 10 \cdot \log_{10} [(V_{\text{Mea}}^2 / R_{\text{ref}}) / 0.001]$, where V_{Mea} is the measured value displayed in the main display area (in the case of a millivolt range, V_{Mea} is the measured value divided by 1000), R_{ref} is the reference resistance and defaults to 600Ω .
- 2) $\text{dB} = 20 \cdot \log_{10}(V_{\text{Mea}} / V_{\text{Ref}})$, where V_{Mea} is the measured value displayed in the main display area (in the case of a millivolt range, V_{Mea} is the measured value divided by 1000), V_{Ref} is the reference voltage and defaults to 1V.

5.4 REL

In the voltage (DC voltage, AC voltage), current (DC current, AC current), resistance (2-wire resistance, 4-wire resistance), frequency, period, capacitance measurement function:

Press **REL** to select the REL function, as shown in Figure 5-9. Press **REL** again to exit the REL function.

In the interface of Figure 5-9, press the Enter key to call up the relative value setting interface. The up / down / left / right arrow key can be used to modify the relative value, as shown in Figure 5-10.

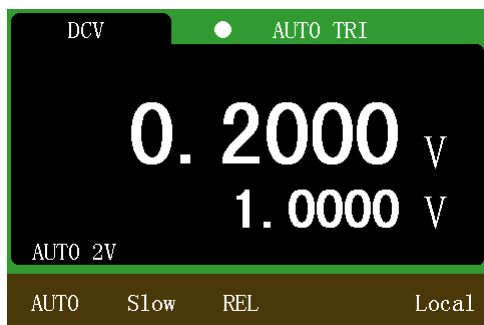


Figure 5-9 REL measurement interface



Figure 5-10 Relative value setting interface

5.5 COMP HI and COMP LOW

In the voltage (DC voltage, AC voltage) measurement function:

1. Press **SHIFT** + **HI SAVE** key combination to select the COMP HI function, as shown in Figure 5-11. Press the key combination again to exit the COMP HI function.
2. Press **SHIFT** + **LO MEM** key combination to select the COMP LOW function, as shown in Figure 5-13. Press the key combination again to exit the COMP LOW function.
3. In the upper limit comparison interface shown in Figure 5-11, press the Enter key to call up the upper limit setting interface. The up / down / left / right arrow key can be used to modify the upper limit, as shown in Figure 5-12.
4. In the lower limit comparison interface shown in Figure 5-13, press the Enter key to call up the lower limit setting interface. The up / down / left / right arrow key can be used to modify the lower limit, as shown in Figure 5-14.

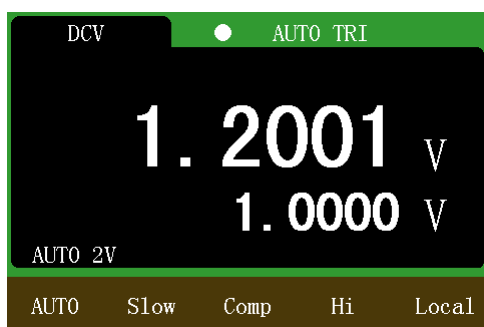


Figure 5-11 Upper limit comparison interface

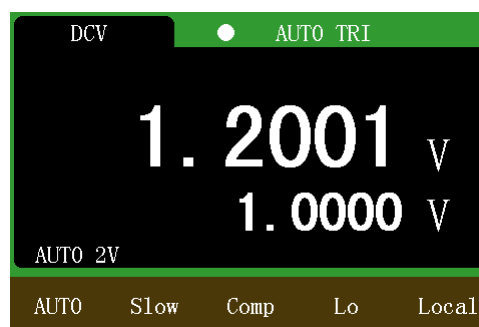


Figure 5-13 Lower limit comparison interface

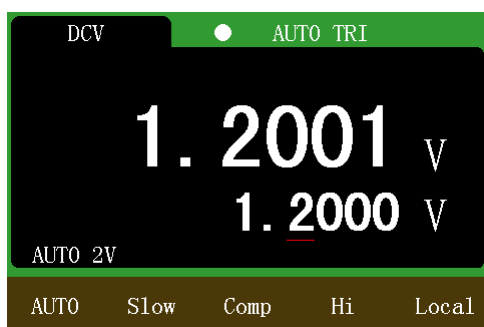


Figure 5-12 Upper limit setting interface

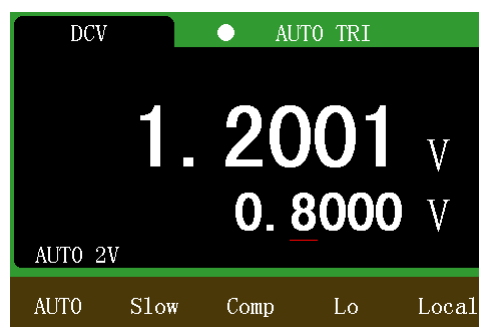


Figure 5-14 Lower limit setting interface

Note:

When the measured value exceeds the upper limit or below the lower limit, the buzzer alarms. When the measured value is restored below the upper limit or above the lower limit, the buzzer no longer alarms.

5.6 Statistics

In the voltage (DC voltage, AC voltage), current (DC current, AC current), resistance (2-wire resistance, 4-wire resistance), capacitance measurement function:

- Press **SHIFT** + **Enter** key combination to select the statistics function, as shown in Figure 5-15. Press the key combination again to exit the statistics function.







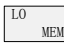
Figure 5-15 Statistical function interface

Note:

- 1) When the statistics function is turned on, the maximum, minimum, average, and variance of the measurement are displayed simultaneously.
- 2) To re-statistics, you can exit the statistics function and then select the function.

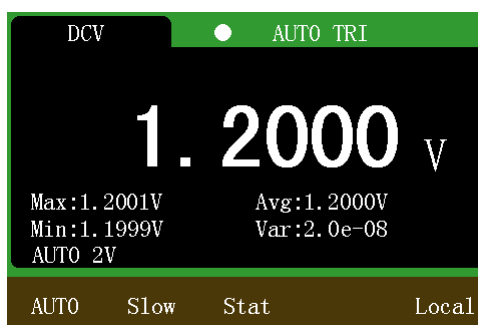5.7 Data storage and readback

In the voltage (DC voltage, AC voltage), current (DC current, AC current), resistance (2-wire resistance, 4-wire resistance), frequency, period, capacitance measurement function:

1. Press  to select the save function, as shown in Figure 5-16. Press  again to exit the save function.
2. Press  to view the saved data, as shown in Figure 5-17. Press  again to exit the data readback function.

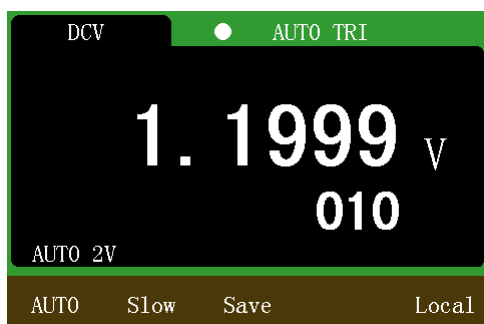


Figure 5-16 Data save function

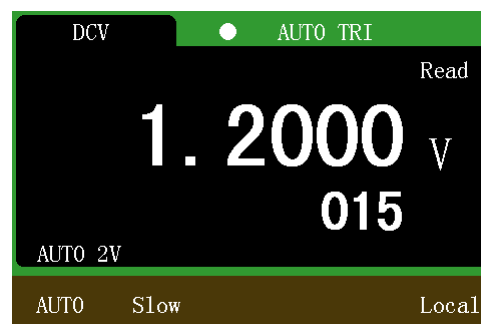




Figure 5-17 Data readback function

Note:

- 1) The save function saves the function name, trigger mode, range mode, display range, sampling rate, measured value, etc. under the measurement function.
- 2) In the data readback function, the up / down arrow key can be used to view the relevant information of the saved measured value in turn.
- 3) The save function can save up to 600 sets of data at the same time. If more than 600 groups, the earliest saved data will be discarded in turn.

5.8 Graphic display

In the voltage (DC voltage, AC voltage), current (DC current, AC current), resistance (2-wire resistance, 4-wire resistance), capacitance measurement function:

Press  +  key combination to enter the display type selection interface, as shown in Figure 5-18. In the interface, press the up / down arrow key, the dot cursor will move up and down, press

the Enter key to select the corresponding display type.

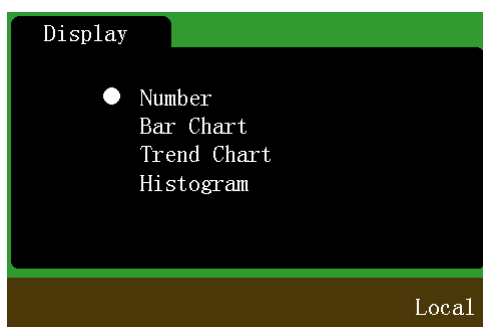


Figure 5-18 Display type selection interface

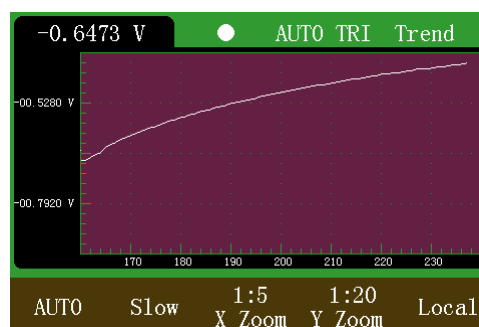


Figure 5-20 Trend chart display interface

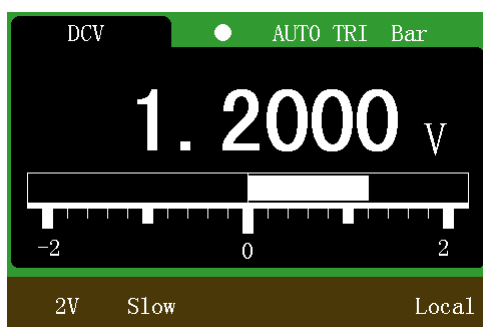


Figure 5-19 Bar display interface

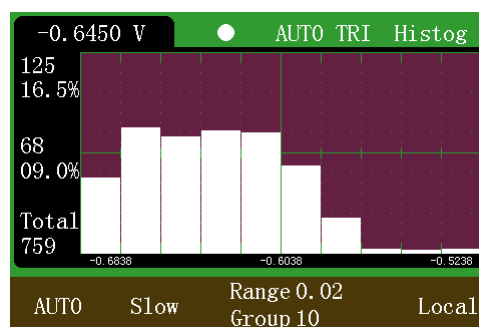


Figure 5-21 Histogram display interface




5.8.1 Bar Meter

In the interface of Figure 5-18, press the up / down arrow key to keep the dotted cursor in the "Bar chart" position and then press the Enter key to select the bar graph display, as shown in Figure 5-19.

5.8.2 Trend Chart

In the interface of Figure 5-18, press the up / down arrow key to keep the dotted cursor in the "Trend chart" position and then press the Enter key to select the trend graph display, as shown in Figure 5-20.

Note:

- 1) The trend chart shows the trend of data changes since the function is turned on. Up to 400 data points can be displayed on the screen.
- 2) In the trend chart interface, press the left / right arrow key to switch the measured speed, such as slow, medium, fast.
- 3) Press the up / down arrow key to manually switch the range; Press  to select the automatic range.
- 4) Press , and then press the left / right arrow key to select the X axis scaling. The optional scaling is: 1: 1, 1: 5, 1: 10.
- 5) Press , and then press the up / down arrow key to select the Y axis scaling. The optional scaling is: 1: 1, 1: 5, 1: 10.

5.8.3 Histogram


In the interface of Figure 5-18, press the up / down arrow key to keep the dotted cursor in the "histogram" and then press the Enter key to select the histogram display, as shown in Figure 5-21.


Note:

- 1) The histogram shows the data statistics after the function is turned on or after the refresh. Can

count up to 2000 points.

2) In the histogram display interface, press the left / right arrow key to switch the measurement speed, such as slow, medium, fast.

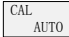3) Press the up / down arrow key to manually switch the range; Press  to select the automatic range.

4) In the histogram display interface (if you are setting the group distance, exit first), press the , and then press the left / right arrow key to select the number of groups.


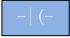
5) In the histogram display interface (if the shift key has been pressed, exit first), press the Enter key, and then press the up / down / left / right arrow key to set the group distance, press the Enter key again to confirm;

6) The meaning of the Y-axis data from top to bottom is the number of the most frequently occurring data and its percentage in the total, the number of data beyond the scope of the statistics and its percentage in the total, the total number of data currently counted.

7) X axis shows a total of three values, the middle value is the value of the first number when the histogram starts to be displayed or refreshed, the value of the left and right is centered on the intermediate value, in terms of group number and group distance as a reference, decrement and increment.

8) In the following cases, the histogram will be refreshed: 1. when the column bar is close to the top of the histogram display area, the column bars are scaled down in a certain proportion; 2. the total number of data reached 2000; 3. group number or group distance changes; 4. When the number of data beyond the statistical range exceeds 50% and the total number of data exceeds 100 (it is recommended to modify the group distance to expand the statistical range when frequently refreshed).

5.9 Temperature

Press  +  key combination to select the temperature measurement function, as shown in Figure 5-22 and Figure 5-23.

Note:

- 1) Thermocouples and thermal resistors can be used in the temperature measurement function. Available thermocouple types are K, N, R, S, T, B, E, J, WRe325 and WRe326. Available thermal resistors types are : PT100, PT50, Cu100, Cu50.
- 2) The measurable temperature range depends on the type of temperature sensor used. The instrument has been set within the various types of sensors within the full range of temperature data, theoretically can measure the full range of temperature.
- 3) In the interface shown in Figure 5-22, press the left / right arrow key to switch the type of temperature sensor. Such as thermocouple, thermal resistance. Press the up / down arrow key to switch between the same type of temperature sensor. Such as K-type, N-type thermocouple and so on.
- 4) In the interface shown in Figure 5-23, press the Enter key to manually adjust the thermocouple cold junction temperature value, but can also by the internal thermistor automatically cold junction temperature compensation.

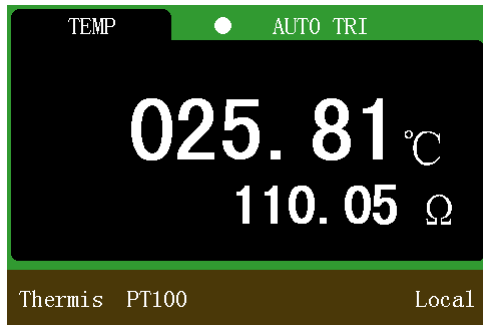


Figure 5-22 Thermal resistance temperature measurement



Figure 5-23 Thermocouple temperature measurement

5.10 Customize the sensor

Press **SHIFT** + **DC V** key combination to select the custom sensor function, as shown in Figure 5-24.

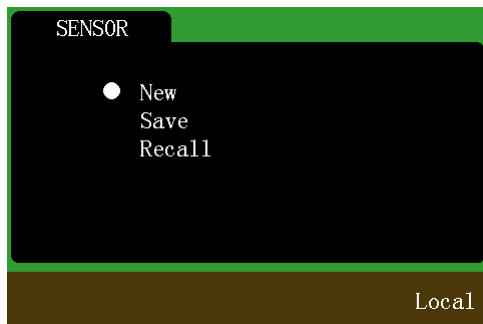


Figure 5-24 Customize the sensor interface

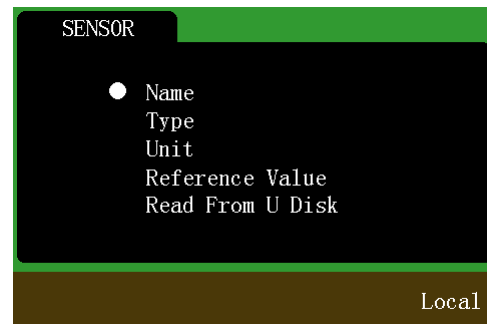


Figure 5-25 New sensor interface

In the custom sensor interface, press the up / down arrow key to move the dot cursor, press the left / right arrow key or Enter key to select the corresponding option at the dot cursor.

5.10.1 New sensor

In the interface shown in Figure 5-24, when the dot cursor stops at "New", press the left / right arrow key or the Enter key to create a new sensor item, as shown in Figure 5-25.

1. When the dot cursor stays at "Name", press the left / right arrow key or the Enter key to name the sensor item, as shown in Figure 5-26. In this interface:

1) Press the up / down arrow key to switch the keyboard.

2) Press the left / right arrow key to switch the selected character on the keyboard; press **SHIFT** + left / right key to switch the sensor characters.

3) Press Enter key to select the character indicated by the underlined cursor on the keyboard and

press **SHIFT** + Enter key to confirm the sensor name.

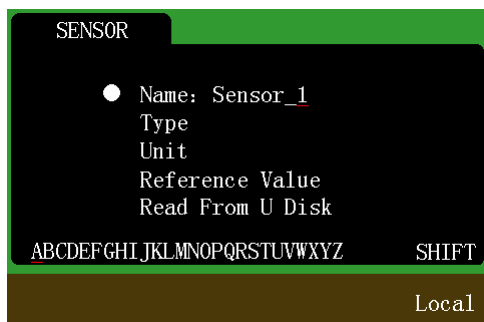


Figure 5-26 Name the sensor item

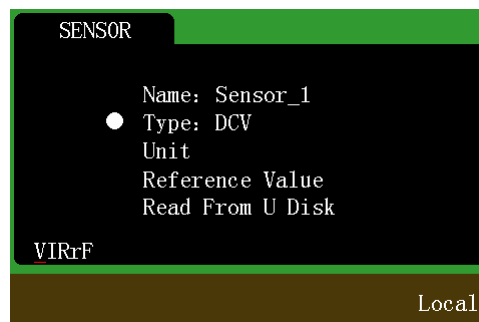




Figure 5-27 Sensor item type selection

2. When the dot cursor stays at "Type", press the left / right arrow key or the Enter key to select the type of measurable value of the sensor, as shown in Figure 5-27. In this interface:

- 1) Press the left / right arrow key to select the measurable type of sensor, such as DC voltage, DC current, 2-wire resistance, 4-wire resistance, frequency and so on.
- 2) Press Enter key to confirm the type of measurable value of the sensor.

3. When the dot cursor stays at "Unit", press the left / right arrow key or the Enter key to select the unit of the sensor, as shown in Figure 5-28. In this interface:

- 1) Press the up / down arrow key to switch the keyboard.
- 2) Press the left / right arrow key to switch the selected character on the keyboard; press  + left or right key to switch the selected character in the sensor unit.
- 3) Press Enter key to select the character indicated by the underscore on the keyboard; press  + Enter key to confirm the sensor unit.

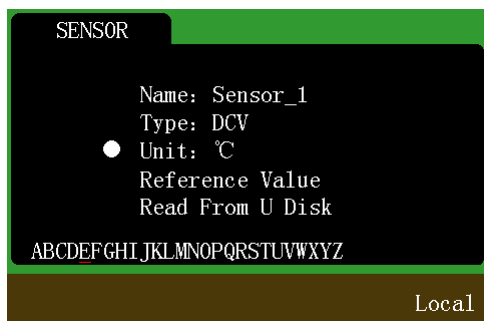


Figure 5-28 Sensor unit selection

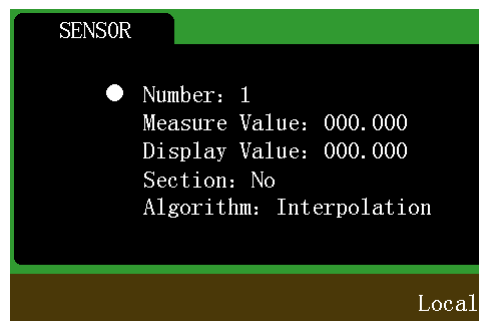




Figure 5-29 Reference value input

4. When the dot cursor stays at "Reference value", press the left / right arrow key or the Enter key to manually enter the correspondence between the measured value and the value to be displayed by the sensor, as shown in Figure Figure 5-29. In this interface:

- 1) When the dot cursor stays at "Number", press the left / right arrow key to view the data for a particular data set, and press  + left / right arrow key to decrease / increase the number of groups of data sets.
- 2) When the dot cursor stays at "Measure value", press the left / right arrow key, then press the up / down arrow key to set the measured value. Press the Enter key to complete the setting of the measured value.
- 3) When the dot cursor stays at "Display value", press the left / right arrow key, then press the up / down arrow key to set the corresponding value. Press the Enter key to complete the setting of the corresponding value.
- 4) When the dot cursor stays at "Section", press the left / right arrow key to select whether to set the

current data set as the segmentation point of the sensor argument.

5) When the dot cursor stays at "Algorithm", press the left / right arrow key to select the algorithm for the current segment interval.

6) When the reference value input is completed, press  + Enter key to end the input of the reference value.

Note:

- 1) The input of the reference value requires at least two groups.
- 2) The measured value is the instrument measurable value, the corresponding value is the value to be displayed.
- 3) The algorithm is valid only at the segmentation point and determines the algorithm used by the data interval between the current segment and the last segment. Alternative algorithms include linear interpolation, second order curve fitting, third order curve fitting, fourth order curve fitting, fifth order curve fitting, and sixth order curve fitting.
5. When the dotted cursor stays at "Read from U disk", press the left or right arrow key or the Enter key to read the corresponding relationship between the measured value of the new sensor item and the value to be displayed directly from the U disk without having to enter it manually through the screen.

5.10.2 Save

In the interface shown in Figure 5-24, when the dot cursor stays at "Save", press the left / right arrow key or the Enter key to save the new sensor items into the FLASH, to facilitate the next call.

5.10.3 Recall

In the interface shown in Figure 5-24, when the dot cursor stays at "Recall", press the left / right arrow key or Enter key to select the called sensor item, as shown in Figure 5-30. If the sensor item is not stored, it can not be called.

In the interface shown in Figure 5-30, press the left / right arrow key to select the called sensor item, press the Enter key to confirm the call. In the interface can also press the up / down arrow key to select to edit or delete the current sensor item.

The sensor measurement interface is shown in Figure 5-31.

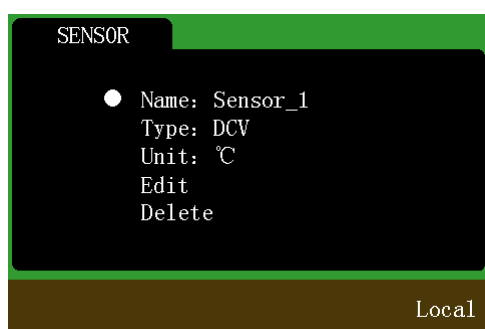


Figure 5-30 Sensor call interface

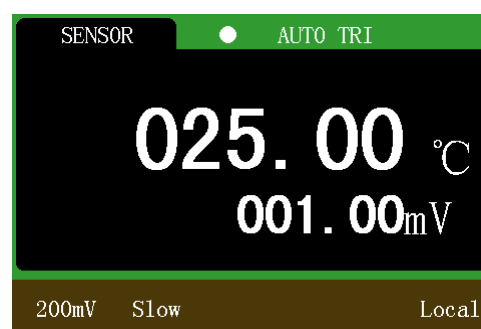


Figure 5-31 Sensor measurement interface

6 System settings

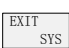
Press  to enter the system setting interface, as shown in Figure 6-1. In this interface, you can view the instrument model, serial number, version number, you can also set the language of the system, switch the buzzer, adjust the screen brightness, switch the interface display style by the up / down / left / right arrow key.



Figure 6-1 System settings interface

6.1 Language switch

In the interface shown in Figure 6-1, press the up / down arrow key to move the dot cursor to "Language", press the left / right arrow key to set the system language.

6.2 Buzzer switch

In the interface shown in Figure 6-1, press the up / down arrow key to move the dot cursor to "Buzzer", press the left / right arrow key to switch the buzzer.

6.3 Screen brightness adjustment

In the interface shown in Figure 6-1, press the up / down arrow key to move the dot cursor to "Light", press the left / right arrow key to adjust the screen brightness percentage.

6.4 Interface style selection

In the interface shown in Figure 6-1, press the up / down arrow key to move the dot cursor to "Interface", press the left / right arrow key to switch the display style of the interface.

7 Technical indicators

- Accuracy: $\pm(a\% \text{reading} + \text{digits})$, guaranteed period of one year.
- Ambient temperature: 18~28°C.
- Ambient humidity: 75%RH.
- Temperature coefficient: $0.1 * (\text{Accuracy})/^\circ\text{C}$.
- Preheating time: 30 minutes.

7.1 DC Voltage

ET3241	ET3241B	ET3242	ET3243	Accuracy	Resolution
Range					
200mV	400mV	500mV	600mV	$\pm(0.02\%+3)$	0.01mV
2V	4V	5V	6V		0.0001V
20V	40V	50V	60V		0.001V
200V	400V	500V	600V		0.01V
1100V	1100V	1100V	1100V		0.1V

Table 7-1 DC Voltage range indicators

Note:

- 1) Full range overload protection: 1100V.
- 2) 200mV(ET3241)/400mV(ET3241B)/500mV(ET3242)/600mV(ET3243) range and 2V(ET3241)/4V(ET3241B)/5V(ET3242)/6V(ET3243) range input impedance > 1G Ω ; other ranges input impedance: 10M Ω .

7.2 AC Voltage(True RMS)

ET3241	ET3241B	Accuracy				Resolution
Range		40Hz~ 5kHz	5kHz~ 30kHz	30kHz~ 50kHz	50kHz~ 100kHz	
200mV	400mV	$\pm(0.2\%+20)$	$\pm(0.3\%+30)$	$\pm(1\%+40)$	$\pm(3\%+40)$	0.01mV
2V	4V	$\pm(0.2\%+20)$	$\pm(0.3\%+30)$	$\pm(1\%+40)$	$\pm(3\%+40)$	0.0001V
20V	40V	$\pm(0.2\%+20)$	$\pm(0.8\%+30)$	$\pm(2.5\%+40)$	$\pm(5\%+40)$	0.001V
200V	400V	$\pm(0.2\%+20)$	$\pm(0.8\%+30)$	--	--	0.01V
800V	800V	$\pm(0.3\%+20)$	--	--	--	0.1V

Table 7-2 ET3241/ET3241B AC Voltage range indicators

ET3242	ET3243	Accuracy				Resolution
Range		40Hz~ 5kHz	5kHz~ 30kHz	30kHz~ 50kHz	50kHz~ 100kHz	
500mV	600mV	$\pm(0.2\%+20)$	$\pm(0.3\%+30)$	$\pm(1\%+40)$	$\pm(3\%+40)$	0.01mV
5V	6V	$\pm(0.2\%+20)$	$\pm(0.3\%+30)$	$\pm(1\%+40)$	$\pm(3\%+40)$	0.0001V
50V	60V	$\pm(0.2\%+20)$	$\pm(0.8\%+30)$	$\pm(2.5\%+40)$	$\pm(5\%+40)$	0.001V
500V	600V	$\pm(0.2\%+20)$	$\pm(0.8\%+30)$	--	--	0.01V
800V	800V	$\pm(0.3\%+20)$	--	--	--	0.1V

Table 7-3 ET3242/ET3243 AC Voltage range indicators

Note:

- 1) Display: True virtual value for 10% to 100% of the range.
- 2) Full range overload protection: 800V RMS.
- 3) Input impedance: 1M Ω .

7.3 DC Current

ET3241		ET3241B		Resolution
Range	Accuracy	Range	Accuracy	
200uA	$\pm(0.1\%+3)$	400uA	$\pm(0.05\%+3)$	0.01uA
2mA		4mA		0.0001mA
20mA		40mA	$\pm(0.1\%+3)$	0.001mA
200mA		400mA		0.01mA
2A	$\pm(0.3\%+3)$	4A	$\pm(0.2\%+3)$	0.0001A
12A		12A		0.001A

Table 7-4 ET3241/ET3241B DC Current range indicators

ET3242	ET3243	Accuracy	Resolution
Range			
500uA	600uA	$\pm(0.05\%+3)$	0.01uA
5mA	6mA		0.0001mA
50mA	60mA		0.001mA
500mA	600mA		0.01mA
5A	6A	$\pm(0.2\%+3)$	0.0001A
12A	12A		0.001A

Table 7-5 ET3242/ET3243 DC Current range indicators

7.4 AC Current

ET3241	ET3241B	Accuracy			Resolution
Range		40Hz~1kHz	1kHz~5kHz	5kHz~10kHz	
200uA	400uA	$\pm(0.3\%+3)$	$\pm(0.5\%+3)$	$\pm(0.8\%+5)$	0.01uA
2mA	4mA				0.0001mA
20mA	40mA				0.001mA
200mA	400mA				0.01mA
2A	4A	$\pm(0.5\%+5)$	$\pm(1\%+5)$	$\pm(1\%+5)$	0.0001A
12A	12A				0.001A

Table 7-6 ET3241/ET3241B AC Current range indicators

ET3242	ET3243	Accuracy			Resolution
Range		40Hz~1kHz	1kHz~5kHz	5kHz~10kHz	
500uA	600uA	$\pm(0.3\%+3)$	$\pm(0.5\%+3)$	$\pm(0.8\%+5)$	0.01uA
5mA	6mA				0.0001mA
50mA	60mA				0.001mA
500mA	600mA				0.01mA
5A	6A	$\pm(0.5\%+5)$	$\pm(1\%+5)$	$\pm(1\%+5)$	0.0001A
12A	12A				0.001A

Table 7-7 ET3242/ET3243 AC Current range indicators

7.5 Resistance

ET3241		ET3241B		Resolution
Range	Accuracy	Range	Accuracy	
200Ω	$\pm(0.05\%+5)$	400Ω	$\pm(0.04\%+5)$	0.01Ω
2kΩ		4kΩ		0.0001Ω
20kΩ		40kΩ		0.001kΩ
200kΩ		400kΩ		0.01kΩ
2MΩ		4MΩ		0.0001MΩ
20MΩ	$\pm(0.2\%+5)$	40MΩ	$\pm(0.15\%+5)$	0.001MΩ
200MΩ	$\pm(5\%+10)$	400M	$\pm(5\%+10)$	0.01MΩ
1GΩ	参考	1GΩ	参考	0.0001GΩ

Table 7-8 ET3241/ET3241B Resistance range indicators

ET3242	ET3243	Accuracy	Resolution
Range			
500Ω	600Ω	$\pm(0.03\%+5)$	0.01Ω
5kΩ	6kΩ		0.0001Ω
50kΩ	60kΩ		0.001kΩ
500kΩ	600kΩ		0.01kΩ
5MΩ	6MΩ	$\pm(0.04\%+5)$	0.0001MΩ
50MΩ	60MΩ	$\pm(0.1\%+5)$	0.001MΩ
500MΩ	600MΩ	$\pm(5\%+10)$	0.01MΩ
1GΩ	1GΩ	参考	0.0001GΩ

Table 7-9 ET3242/ET3243 Resistance range indicators

Note:

For range below 200MΩ, the open circuit voltage is about 3V

7.6 Capacitance

ET3241	ET3241B	ET3242	ET3243	Accuracy	Resolution
Range					
2nF	4nF	5nF	6nF	$\pm(2\%+5)$	0.001nF
20nF	40nF	50nF	60nF		0.01nF
200nF	400nF	500nF	600nF		0.1nF
2uF	4uF	5uF	6uF		0.001uF
20uF	40uF	50uF	60uF		0.01uF
200uF	400uF	500uF	600uF		0.1uF
2mF	4mF	5mF	6mF		0.001mF
10mF	10mF	10mF	10mF		0.01mF

Table 7-10 Capacitance range indicators

7.7 Frequency

ET3241		ET3241B		Resolution
Range	Accuracy	Range	Accuracy	
20Hz	$\pm(0.05\%+3)$	40Hz	$\pm(0.02\%+3)$	0.001Hz
200Hz		400Hz		0.01Hz
2kHz		4kHz		0.0001kHz
20kHz		40kHz		0.001kHz
200kHz		400kHz		0.01kHz
2MHz		4MHz		0.0001MHz
20MHz		20MHz		0.001MHz

Table 7-11 Frequency range indicators

ET3242	ET3243	Accuracy	Resolution
Range			
50Hz	60Hz	$\pm(0.01\%+3)$	0.001Hz
500Hz	600Hz		0.01Hz
5kHz	6kHz		0.0001kHz
50kHz	60kHz		0.001kHz
500kHz	600kHz		0.01kHz
5MHz	6MHz		0.0001MHz
20MHz	20MHz		0.001MHz

Table 7-12 ET3242/ET3243 Frequency range indicators

Note:

The minimum frequency that can be measured is 1 Hz..

7.8 Diode

Range	Input protection	Description
0~2V	250Vp	Input Current is about 0.75mA。

Table 7-13 Diode measurement indicator

Note:

Open circuit voltage is about 3.2V.

7.9 Conductance

Range	Resolution	Input protection	Description
0~1k Ω	0.001k Ω	250Vp	When the measured resistance is less than 30 Ω , the buzzer sounds; when the measured value does not exceed 1k Ω , display the reading, when exceeded, display "-OL-"

Table 7-14 Conductance measurement indicator

Note:

Open circuit voltage is about 3.2V.

7.10 Duty Cycle

Range	Accuracy	Resolution
5.0%~95.0%	0.001	$\pm(3\%+20)$

Table 7-15 Duty cycle measurement indicator

7.11 Temperature

The range and error of the temperature measurement depends on the temperature sensor used. The temperature display accuracy is 0.01 $^{\circ}\text{C}$, the calculation error is less than 0.005%.

8 Calibration

Note:

- 1) Before calibration, it is required to preheat the instrument for more than 30 minutes. The accuracy of the standard source must be better than 3 ~ 5 times the accuracy of the calibrated instrument.
- 2) After a specific range was calibrated, the calibration data is immediately written to FLASH. So you can just calibrate a separate range.
- 3) In order to prevent inaccurate calibration due to wrong operation, it is required to enter a password before the calibration.
- 4) You can enter the calibration interface after input the correct password. Take the interface of DCV calibration as an example.

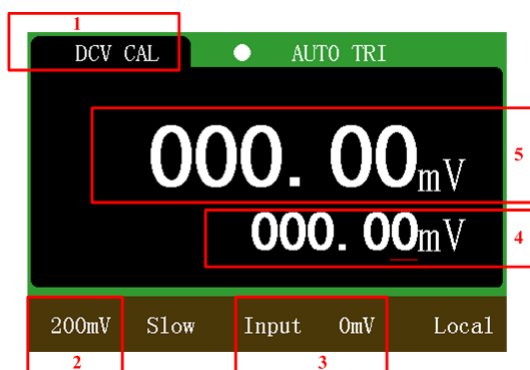




Figure 8-1 Calibration interface

NO.	Description
1	Indicates the currently calibrated function.
2	Indicates the current calibration range.
3	Indicates the value of the standard source that needs to be entered.
4	Used to enter true values. The arrow keys can be used to modify this value.
5	Current measured value.

Table 8-1 Calibration interface description

8.1 DC voltage calibration

Two ways to enter the DC voltage calibration:

1. In the DC voltage measurement function, press  +  key combination, and enter the correct password.

2. Send the corresponding SCPI instruction to multimeter.

Through the panel button to enter the DC voltage calibration function, the start calibration range is the display range before switch. If the calibration function is entered by remote command., the calibration start range is the minimum display range for DC voltage measurement. For example, the minimum display range in DC voltage measurement for ET3241 is 200mV, so the calibration start range is 200mV, after a remote instruction.

200mV calibration steps:

1. Enter 0mV according to the prompt of zone 3 in Figure 8-1. Press Enter key after the measured value in area 5 is stable.
2. Enter -200mV according to the prompt of zone 3 in Figure 8-1. Press Enter key after the measured value is stable.
3. Enter 200mV according to the prompt of zone 3 in Figure 8-1. Press Enter key after the measured value is stable.
4. The calibration program jump to 2V range automatically.

At this point, 200mV range calibration is completed, the calibration data written to FLASH. If the calibration function is exited at this time, a separate calibration of 200mV is completed.

2V calibration steps:

1. Enter 0V according to the prompt of zone 3 in Figure 8-1. Press Enter key after the measured value in area 5 is stable.
2. Enter -0.5V according to the prompt of zone 3 in Figure 8-1. Press Enter key after the measured value is stable.
3. Enter -1V according to the prompt of zone 3 in Figure 8-1. Press Enter key after the measured value is stable.
4. Enter -1.6V according to the prompt of zone 3 in Figure 8-1. Press Enter key after the measured value is stable.
5. Enter -2.2V according to the prompt of zone 3 in Figure 8-1. Press Enter key after the measured value is stable.
6. Enter 2V according to the prompt of zone 3 in Figure 8-1. Press Enter key after the measured value is stable.
7. The calibration program jump to 20V range automatically.

At this point, 2V range calibration is completed, the calibration data written to FLASH. You can press any of the basic function keys to exit the calibration function, or you can choose to continue calibrating the next range.

20V calibration steps:

1. Enter 0V according to the prompt of zone 3 in Figure 8-1. Press Enter key after the measured value in area 5 is stable.
2. Enter 20V according to the prompt of zone 3 in Figure 8-1. Press Enter key after the measured value is stable.
3. The calibration program jump to 200V range automatically.

At this point, 20V range calibration is completed, the calibration data written to FLASH. You can press any of the basic function keys to exit the calibration function, or you can choose to continue calibrating the next range.

200V calibration steps:

1. Enter 0V according to the prompt of zone 3 in Figure 8-1. Press Enter key after the measured value in area 5 is stable.
2. Enter 200V according to the prompt of zone 3 in Figure 8-1. Press Enter key after the measured value is stable.
3. The calibration program jump to 1100V range automatically.

At this point, 200V range calibration is completed, the calibration data written to FLASH. You can press any of the basic function keys to exit the calibration function, or you can choose to continue calibrating the next range.

1100V calibration steps:

1. Enter 0V according to the prompt of zone 3 in Figure 8-1. Press Enter key after the measured value in area 5 is stable.
2. Enter 1000V according to the prompt of zone 3 in Figure 8-1. Press Enter key after the measured value is stable.
3. Area 4 shows "OK".

At this point, the DC voltage calibration is completed. The calibration completion interface is shown in Figure 8-2. At this time, you can press any of the basic function keys to exit the calibration function.

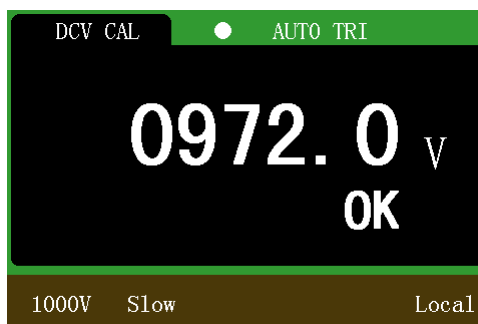


Figure 8-2 DC voltage calibration is completed



8.2 AC voltage calibration

AC voltage calibration is more cumbersome, calibration by user is not recommend. If you has the ability and conditions for calibration, please refer to the AC voltage measurement for wiring, calibration steps refer to the DC voltage calibration.

8.3 DC current calibration

Please refer to the DC current measurement for wiring, calibration steps refer to the DC voltage calibration.

Two ways to enter the DC current calibration:

1. In the DC current measurement function, press the  +  key combination, and correctly enter the calibration password to enter the DC current calibration function. In this way, you can start calibration from any range or calibrate a particular range.
2. The DC current calibration function can also be entered via a specific remote command. In this way, calibration can only be started from the minimum range.

The calibration values that need to be entered for each range are shown below:

1. 200uA range need to enter 0 uA and 200 uA total of two values.
2. 2mA range need to enter 0 mA and 2 mA total of two values.
3. 20mA range need to enter 0 mA and 20 mA total of two values.
4. 200mA range need to enter 0 mA and 200 mA total of two values.
5. 2A file need to enter 0 A and 2 A total of two values.



Warning:

DC current calibration, when the range is switched from 200mA to 2A, to ensure that the multimeter and personal safety, please promptly adjust the input terminal wiring.

8.4 AC current calibration

Please refer to the AC current measurement for wiring, calibration steps refer to the DC voltage calibration.

Two ways to enter the AC current calibration:

1. In the AC current measurement function, press the  +  key combination, and correctly enter the calibration password to enter the AC current calibration function. In this way, you can start calibration from any range or calibrate a particular range.
2. The AC current calibration function can also be entered via a specific remote command. In this way, calibration can only be started from the minimum range.

The calibration values that need to be entered for each range are shown below:

1. 200uA range need to enter 0 uA and 200 uA total of two values.
 2. 2mA range need to enter 0 mA and 2 mA total of two values.
 3. 20mA range need to enter 0 mA and 20 mA total of two values.
 4. 200mA range need to enter 0 mA and 200 mA total of two values.
 5. 2A range need to enter 0.2A, 0.4A, 0.6A, 0.8A, 1A, 1.2A, 1.4A, 1.6A, 1.8A and 2A total of ten values.
 6. 12A range need to enter 1A and 2A total of two values.
- The frequency of the above calibration values is 1kHz.



Warning:

AC current calibration, when the range is switched from 200mA to 2A, to ensure that the multimeter and personal safety, please promptly adjust the input terminal wiring.

8.5 Resistance calibration

Please refer to the resistance measurement for wiring, calibration steps refer to the DC voltage calibration.

Two ways to enter the resistance calibration:

1. In the resistance measurement function, press the  +  key combination, and correctly enter the calibration password to enter the resistance calibration function. In this way, you can start calibration from any range or calibrate a particular range.
2. The resistance calibration function can also be entered via a specific remote command. In this way, calibration can only be started from the minimum range.

The calibration values that need to be entered for each range are shown below:

1. 200 Ω range need to enter 0 Ω , 100 Ω , 190 Ω total of three values.
2. 2 k Ω range need to enter 0 k Ω , 1 k Ω , 1.9k Ω total of three values.
3. 20 k Ω range need to enter 0 k Ω , 10 k Ω , 19k Ω total of three values
4. 200 k Ω range need to enter 0 k Ω , 100 k Ω , 190k Ω total of three values
5. 2 M Ω range need to enter 0 M Ω , 1 M Ω , 1.9M Ω total of three values.
6. 20 M Ω range need to enter 0 M Ω , 10 M Ω , 19M Ω total of three values.
7. 200 M Ω range need to enter 0 M Ω , 100 M Ω , 200M Ω total of three values.

Note:



- 1) 2-wire resistance / 4-wire resistance are required to be calibrated.
- 2) The calibration procedure is carried out from low to high range.

3) When the calibration is completed and the next range is switched, the calibration data for that range has been saved and the calibration procedure can be exited at any time.

8.6 Capacitance calibration

Please refer to the capacitance measurement for wiring, calibration steps refer to the DC voltage calibration.

Two ways to enter the capacitance calibration:

1. In the capacitance measurement function, press the  +  key combination, and correctly enter the calibration password to enter the capacitance calibration function. In this way, you can start calibration from any range or calibrate a particular range.
2. The capacitance calibration function can also be entered via a specific remote command. In this way, calibration can only be started from the minimum range.

The calibration values that need to be entered for each range are shown below:

1. 2 nF range need to enter 0 nF and 2 nF total of two values.
2. 20 nF range need to enter 0 nF and 20 nF total of two values.
3. 200 nF range need to enter 0 nF and 200 nF total of two values.
4. 2 uF range need to enter 0 uF and 2 uF total of two values.
5. 20 uF range need to enter 0 uF and 20 uF total of two values.
6. 200 uF range need to enter 0 uF and 200 uF total of two values.
7. 2 mF range need to enter 0 mF and 2 mF total of two values.
8. 10 mF range need to enter 0 mF and 10 mF total of two values.

9 Communication Interface

RS232 interface connection settings:

The multimeter can be connected to the computer via a male and female parallel serial cable. RS232 interface baud rate, data bit, stop bit can be set as shown in Figure 9-1.

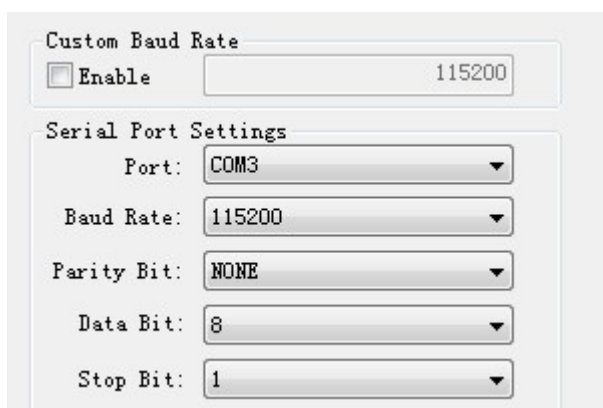


Figure 9-1 Serial port configuration

USB Device interface

The multimeter can be connected to the computer via the USB cable.

Before using USB, install the USB-to-serial driver of STM32 on PC.

Please turn on the power before connecting the multimeter with the USB cable.

USB Host interface

USB Host interface can make the multimeter with U disk function. When using the custom sensor function, multimeter can directly read the measurable value and displayed value stored in the U disk. U disk can also be used in the multimeter screenshots.

GPIB, LAN, WIFI, Bluetooth can be used in multimeter communication with other devices, send the multimeter measurements to other devices.

10 Related software installation and use

(See the Operating Instructions in the software CD attached.)

11 Maintenance and upkeep

11.1 General maintenance and repair

Multimeter is a precision measuring instrument, please keep the instrument clean, tidy and gently.

About one year after the instrument is used, recalibrate the instrument to ensure that the indicators meet the requirements.

If the recalibration or repair of the instrument is needed, send it back to the manufacturer or dealer, and to have it repaired or calibrated by a qualified professional.

11.2 Replace the fuse

Fuse installation location can refer to the Figure 3-4, one for the power fuse, one for the current fuse.

Fuse tube specifications:

ET3241/ET3241B use 0.5A L 250V fast-blow fuse, ET3242/ET3243 use 1A L 250V fast-blow fuse; Fuse specifications are $\Phi 5 \times 20$ mm.

Steps:

Turn off the power and unplug the power cord.

Find the location of the fuse, remove the blown fuse according to the prompts on the instrument.

Replace the fuse, and install the new fuse.